

VaproTip - In cooler climates and colder weather, keep the tape warm for easier application.
VaproTip - All VaproTapes work best when applied using a pressure roller.


Special Instructions

It is best to have 100% contact with the surface for VaproTape to perform at its best. Often surface variations can cause the following issues:

Air bubble: Larger than a quarter “25¢” in diameter


Tenting: Within ¾” of the edge of VaproTape

Curve openings: Creating openings along the edge of VaproTape

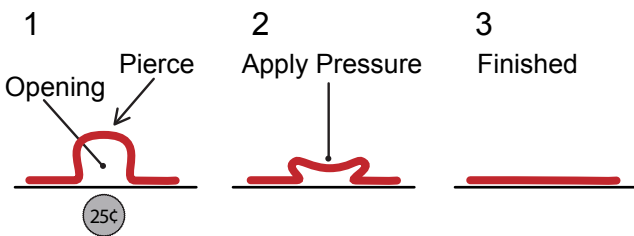


Air Bubble

Lance, cut or pierce the bubble and squeeze out the air. VaproTape will self-seal the opening.

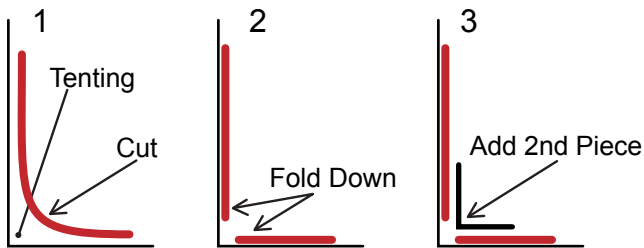

Tenting

Cut the tented area so VaproTape can be folded down flat. Apply a smaller piece of VaproTape to seal the cut area.

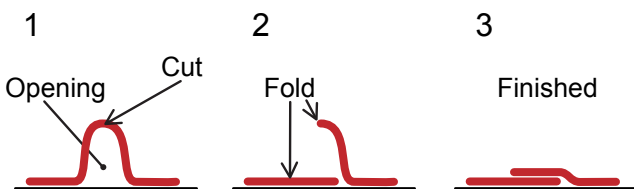

Curve Openings

This typically occurs when VaproTape is bunched together.

Solution A

Cut bunched VaproTape with a razor (or sharp blade) so it can be folded down. Press one side of the cut VaproTape against the surface, then the other side over the first. Apply a second smaller piece of VaproTape to seal the cut area.



Solution B

Press down the opening and seal the edge with a second piece of VaproTape or a high quality butyl sealant.